



merit industries, inc.

FIELD BULLETIN

Date: 6-29-06

- Issue:** Some MoD BoX jukeboxes were built with the coin switch wired incorrectly.
- Games affected:** MoD BoX jukeboxes built prior to June 23, 2006. The first six digits of the serial number represent the date the game was built.
- Symptoms:** If the coin mech is wired incorrectly, the coins may not always register.
- Solution:** Unlock and open the MoD BoX door and check the wiring of the coin mech mounted on the door. The wires should be connected to the outside terminals on the coin switch (the common and normally closed tabs) as shown in the picture below. If the coin mech wiring is incorrect, turn off the jukebox and move the fast-on connector from the normally open tab to the normally closed tab as shown below.

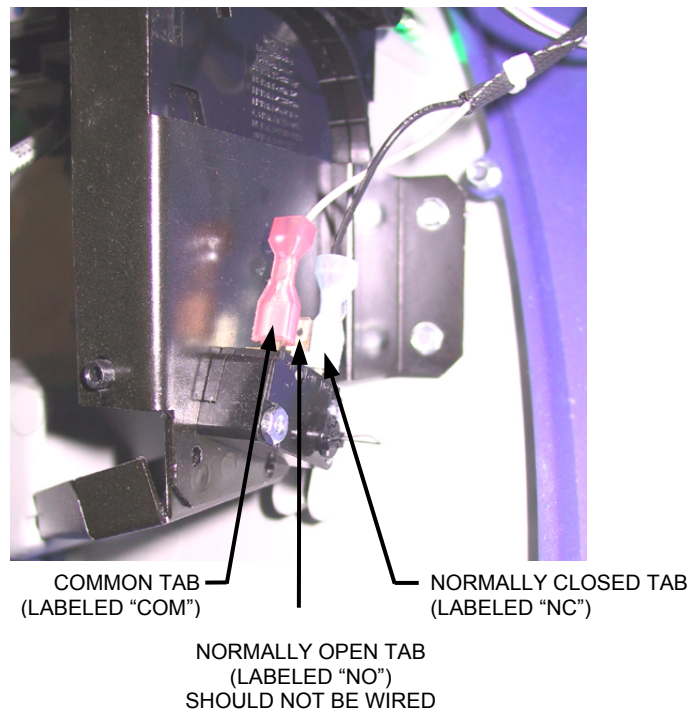


FIGURE 1 – CORRECT WIRING OF MOD BOX COIN MECH

If you have any questions, please contact Merit Customer Service and Technical Support by phone at 215-639-4700 or 1-800-523-2760 or by E-mail: TechCenter@meritind.com